

# Hill Farm

## Level 1 Reserve Study



**Report Period – 01/01/2021 – 12/31/2021**

<b>Client Reference Number</b>	<b>18113</b>
<b>Property Type</b>	<b>Single Family Homes</b>
<b>Number of Units</b>	<b>221</b>
<b>Fiscal Year End</b>	<b>12/31</b>

<b>Type of Study</b>	<b>Full Study</b>
<b>Date of Property Inspection</b>	<b>6/4/2020</b>
<b>Prepared By</b>	<b>Dale Gifford</b>
<b>Analysis Method</b>	<b>Cash Flow</b>
<b>Funding Goal</b>	<b>Full Funding</b>

**Report prepared on – Monday, June 22, 2020**



**TEL: (888) 356-3783 | Fax: (866) 279-9662**  
**WWW.COMPLEXSOLUTIONSLTD.COM**

# Table of Contents

## Introduction

---

- Executive Summary page 1
- Introduction page 2
- General Information and Frequently Asked Questions page 3 - 4

## Reserve Analysis

---

- Funding Summary page 5
- Percent Funded – Graph page 6
- Component Inventory page 7
- Significant Components page 8
- Significant Components – Graph page 9
- Yearly Summary page 10
- Yearly Reserve Contributions – Graph page 11
- Component Funding Information page 12
- Yearly Cash Flow page 13
- Yearly Reserve Expenditures – Graph page 14
- Projected Reserve Expenditures by Year page 15

## Component Evaluation

---

- Component Evaluation page 1 - 17

## Glossary of Commonly used Words and Phrases

---

## Executive Summary – Hill Farm - ID # 18113

Information to complete this Reserve Study was gathered by performing an on-site inspection of the common area elements. In addition, we also obtained information by contacting any vendors and/or contractors that have worked on the property recently, as well as communicating with the property representative (BOD Member and/or Community Manager). To the best of our knowledge, the conclusions and recommendations of this report are considered reliable and accurate insofar as the information obtained from these sources.

<b>Projected Starting Balance as of 01/01/2021</b>	<b>\$47,812.23</b>
<b>Ideal Reserve Balance as of 01/01/2021</b>	<b>\$164,080</b>
<b>Percent Funded as of 01/01/2021</b>	<b>29%</b>
<b>Recommended Reserve Contribution (per month)</b>	<b>\$4,000</b>
<b>Recommended Special Assessment</b>	<b>\$0</b>

Hill Farm is a 221-unit Single Family Home community. The community offers playground areas, and landscaped areas as amenities. Construction on the community was completed in 2020.

### Currently Programmed Projects

Projects programmed to occur this fiscal year (FY2021) include asphalt seal coat (Comp# 402). We have programmed an estimated \$24,500 in reserve expenditures toward the completion of these projects. (See page 15)

### Significant Reserve Projects

The association's significant reserve projects are landscaping and irrigation system renovate (Comp# 1812 asphalt major rehab (Comp# 401), asphalt seal coat (Comp# 402), and split rail fencing replace (Comp# 1009). The fiscal significance of these components is approximately 20%, 20%, 14%, and 11% respectively (see page 9). A component's significance is calculated by dividing its replacement cost by its useful life. In this way, not only is a component's replacement cost considered but also the frequency of occurrence. These components most significantly contribute to the total monthly reserve contribution. As these components have a high level of fiscal significance the association should properly maintain them to ensure they reach their full useful lives.

### Reserve Funding

In comparing the projected starting reserve balance of \$47,812.23 versus the ideal reserve balance of \$164,080 we find the association's reserve fund to be approximately 29% funded. This indicates a weak reserve fund position. In order to continue to strengthen the account fund, we suggest adopting a monthly reserve contribution of \$4,000 (\$18.10/unit) per month. If the contribution falls below this rate, then the reserve fund may fall into a situation where special assessments, deferred maintenance, and lower property values are likely at some point in the future.

# Introduction

## Reserve Study Purpose

The purpose of this Reserve Study is to provide the Association with a budgeting tool to help ensure that there are adequate reserve funds available to perform future reserve projects. The detailed schedules will serve as an advance warning that major projects will need to be addressed in the future. This will allow the Association to have ample time to obtain competitive bids for each project. It will also help to ensure the physical well-being of the property and ultimately enhance each owner's investment, while limiting the possibility of unexpected major projects that may lead to special assessments.

## Preparer's Credentials

Mr. Gifford has been working in the community association industry for the last 16 years. Prior to taking a position, as the Regional Project Manager covering the Utah region, at Complex Solutions, he worked in community association management in Utah. While in community association management his positions included, Maintenance Supervisor, Senior Portfolio Manager and Vice President of Community Management. His work in community association management gave him extensive experience with; budget creation, reserves and reserve budgeting, community inspections and analyzing common area components.

- Professional Reserve Analyst (PRA) designation from Association of Professional Reserve Analysts (APRA), PRA #2320
- Reserve Specialist (RS) designation from Community Associations Institute (CAI), RS# 231
- Personally has prepared over 1,400 reserve studies in Salt Lake City Utah and surrounding areas
- Bachelor of Science in Chemistry from Emporia State University
- Certified Manager of Community Associations® (CMCA®) designation from the National Board of Certification for Community Association Managers (NBC-CAM)
- Association Management Specialist® (AMS®) designation from Community Associations Institute (CAI)
- Professional Community Association Manager® (PCAM®) designation from Community Associations Institute (CAI), PCAM# 1740,
- Active member and former Board member and chapter President of the Utah Chapter of Community Associations Institute (UCCAI)
- Recipient of Community Associations Institute's (CAI) annual award of Excellence in Chapter Leadership for service an achievement in 2010

## Budget Breakdown

Every association conducts their business within a budget. There are typically two main parts to this budget, the Operating budget and the Reserve budget. The operating budget includes all expenses that occur on an annual basis as well as general maintenance and repairs. Typical operating budget line items include management fees, maintenance expenses, utilities, etc. The reserve budget is primarily made up of replacement items such as roofing, fencing, mechanical equipment, etc., that do not normally occur on an annual basis.

## Report Sections

**Reserve Analysis:** this section contains the evaluation of the association's reserve balance, income, and expenses. It includes a finding of the client's current reserve fund status (measured as percent funded) and a recommendation for an appropriate reserve allocation rate (also known as the funding plan).

**Component Evaluation:** this section contains information regarding the physical status and replacement cost of reserve components the association is responsible to maintain. It is important to understand that while the component inventory will remain relatively "stable" from year to year, the condition assessment and life estimates will most likely vary from year to year.

## General Information and Frequently Asked Questions

### **Is it the law to have a Reserve Study conducted?**

The Government requires a reserve study in approximately 20 states. Also, the Association's governing documents may require a reserve fund be established. This does not mean a Reserve Study is required, but how are you going to know if you have enough money in the reserve fund if you do not have the proper information?

### **Why is it important to perform a Reserve Study?**

This report provides the essential information that is needed to guide the Association in establishing the reserve portion of the total monthly assessment. The reserve fund is critical to the future of the association because it helps ensure that reserve projects can be completed on time. When projects are completed on time, deferred maintenance and the lower property values that typically accompany it can be avoided. It is suggested that a third party professionally prepare the Reserve Analysis Study since there is no vested interest in the property.

### **After we have a Reserve Study, what do we do with it?**

Please take the time to review the report carefully and make sure the component information is complete and accurate. If there are any inaccuracies, or changes such as a component that the association feels should be added, removed, or altered, please inform us immediately so we may revise the report. Use the report to help establish your budget for the upcoming fiscal year.

### **How often do we review and update our Reserve Study?**

There is a misconception that a Reserve Study is good for an extended period of time since the report has projections for a thirty year period. The assumptions, interest rates, inflation rates and other information used to create this report change each year. Scheduled events may not happen, unpredictable circumstances could occur, deterioration rates can be unpredictable and repair/replacement costs will vary from causes that are unforeseen. These variations alter the results of the Reserve Study. The Reserve Study should be professionally reviewed each year by having a Level III "no site visit" update reserve study performed. The Reserve Study should be professionally updated every three years by having a Level II "site visit" update reserve study performed.

### **What is a "Reserve Component" versus an "Operating Component"?**

A "Reserve" component is an item that is the responsibility of the association to maintain, has a limited useful life, predictable remaining useful life, typically occurs on a cyclical basis that exceeds one year, and costs above a minimum threshold amount. An "Operating" component is typically a fixed expense that occurs on an annual basis.

### **What are the GREY areas of "maintenance" items that are often seen in a Reserve Study?**

One of the most popular questions revolves around major "maintenance" items, such as painting the buildings or seal coating the asphalt. You may hear from your accountant that since painting or seal coating is not replacing a "capital" item, it cannot be considered a reserve component. However, it is the opinion of several major Reserve Study providers, including Complex Solutions, that these components meet the criteria of a reserve component.

### **Information and Data Gathered:**

The information contained in this report is based on estimates and assumptions gathered from various sources. Estimated life expectancies are based upon conditions that were readily visible and accessible at the time of the site visit. While every effort has been made to ensure accurate results, this report reflects the judgment of Complex Solutions, Ltd. and should not be construed as a guarantee or assurance of predicting future events.

### **What happens during the Site Visit?**

During the site visit we identify the common area components that we have determined require reserve funding. These components are quantified and a physical condition is observed. The site visit is conducted on the common areas as reported by client.

### **What is the Financial Analysis?**

We project the starting balance by taking the most recent reserve fund balance as stated by the client and add expected reserve contributions to the end of the fiscal year. We then subtract the expenses of any pending projects. We compare this number to the Fully Funded Balance and arrive at the Percent Funded level. Based on that level of funding we then recommend a Funding Plan to help ensure the adequacy of funding in the future.

**Measures of reserve fund financial strength are as follows:**

- 0% - 30% Funded** is considered a “weak” financial position. Associations that fall into this category are more likely to have special assessments and deferred maintenance. Action should be taken to improve the financial strength of the reserve fund.
- 31% - 69% Funded** is considered a “fair” financial position. Associations that fall into this category are less likely to experience special assessments and deferred maintenance than being in a weak financial position. Action should be taken to improve the financial strength of the reserve fund.
- 70% - 99% Funded** is considered a “strong” financial position. Associations that fall into this category are less likely to experience special assessments and deferred maintenance than being in a fair financial position. Action should be taken to improve the financial strength of the reserve fund.
- 100% Funded** is considered an “ideal” financial position. Action should be taken to maintain the financial strength of the reserve fund.

**Disclosures:**

Information provided to the preparer of a reserve study by an official representative of the association regarding financial, historical, physical, quantitative or reserve project issues will be deemed reliable by the preparer. A reserve study will be a reflection of information provided to the preparer of the reserve study. The total of actual or projected reserves required as presented in the reserve study is based upon information provided that was not audited.

A reserve study is not intended to be used to perform an audit, an analysis of quality, a forensic study or a background check of historical records. An on-site inspection conducted in conjunction with a reserve study should not be deemed to be a project audit or quality inspection.

The results of this study are based on the independent opinion of the preparer and his experience and research during the course of his career in preparing Reserve Studies. In addition the opinions of experts on certain components have been gathered through research within their industry and with client’s actual vendors. There is no implied warranty or guarantee regarding our life and cost estimates/predictions. There is no implied warranty or guarantee in any of our work product. Our results and findings will vary from another preparer’s results and findings. A Reserve Study is necessarily a work in progress and subsequent Reserve Studies will vary from prior studies.

The projected life expectancy of the reserve components and the funding needs of the reserves of the association are based upon the association performing appropriate routine and preventative maintenance for each component. Failure to perform such maintenance can negatively impact the remaining useful life of the component and dramatically increase the funding needs of the reserves of the association.

This Reserve Study assumes that all construction assemblies and components identified herein are built properly and are free from defects in materials and/or workmanship. Defects can lead to reduced useful life and premature failure. It was not the intent of this Reserve Study to inspect for or to identify defects. If defects exist, repairs should be made so that the construction components and assemblies at the community reach the full and expected useful lives.

**Site Visits:** Should a site visit have been performed during the preparation of this reserve study no invasive testing was performed. The physical analysis performed during the site visit was not intended to be exhaustive in nature and may have included representative sampling. Estimated life expectancies and life cycles are based upon conditions that were readily accessible and visible at the time of the site visit. We have assumed any and all components have been properly built and will reach normal, typical life expectancies. A reserve study is not intended to identify or fund for construction defects. We did not and will not look for or identify construction defects during our site visit. In addition, environmental hazards (such as lead paint, asbestos, radon, etc.), have been excluded from this report.

**Update Reserve Studies:**

**Level II Studies:** Quantities of major components as reported in previous reserve studies are deemed to be accurate and reliable. The reserve study relies upon the validity of previous reserve studies.

**Level III Studies:** In addition to the above we have not visited the property when completing a Level III “No Site Visit” study. Therefore we have not verified the current condition of the components.

**Insurance:** We carry general and professional liability insurance as well as workers’ compensation insurance.

**Actual or Perceived Conflicts of Interest:** There are no potential actual or perceived conflicts of interest that we are aware of.

**Inflation and Interest Rates:** The after tax interest rate used in the financial analysis may or may not be based on the clients reported after tax interest rate. If it is, we have not verified or audited the reported rate. The inflation rate may also be based on an amount we believe appropriate given the 30-year horizon of this study and may or may not reflect current or historical inflation rates.

# Funding Summary

## Beginning Assumptions

---

# of units	221
Fiscal Year End	31-Dec
Budgeted Monthly Reserve Allocation	\$1,480
Projected Starting Reserve Balance	\$47,812
Ideal Starting Reserve Balance	\$164,080

## Economic Assumptions

---

Projected Inflation Rate	3.00%
Reported After-Tax Interest Rate	0.10%

## Current Reserve Status

---

Current Balance as a % of Ideal Balance	29%
-----------------------------------------	-----

## Recommendations

---

Recommended Monthly Reserve Allocation	\$4,000
Per Unit	\$18.10
Future Annual Increases	3.00%
For number of years:	30
Increases thereafter:	0.00%
70% Funded Monthly Reserve Allocation Reference	\$3,650
Per Unit	\$16.52
Future Annual Increases	3.00%
For number of years:	30
Increases thereafter:	0.00%


## Changes From Prior Year

---

Recommended Increase to Reserve Allocation as Percentage	\$2,520 170%
-------------------------------------------------------------	-----------------



# Percent Funded - Graph

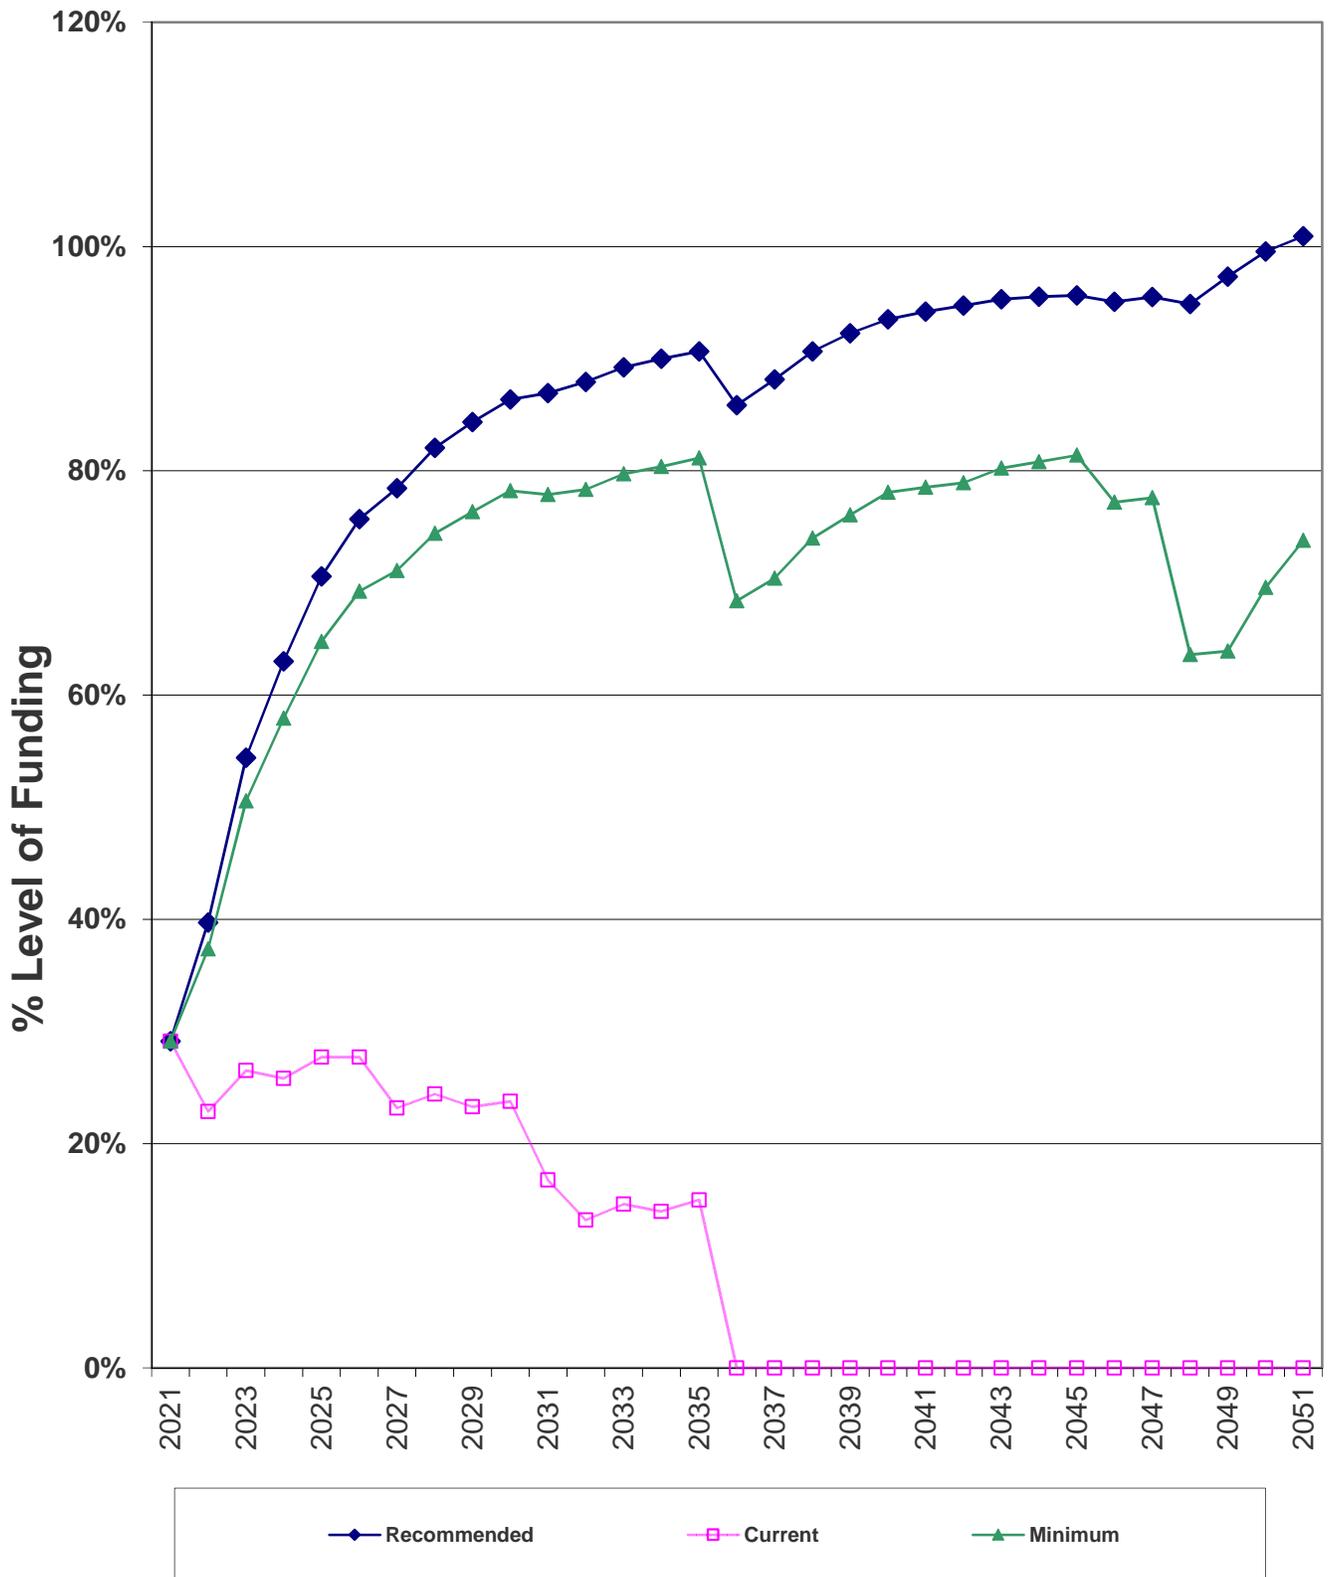



## Component Inventory

Category	ID #	Component Name	Useful Life (yrs.)	Remaining Useful Life (yrs.)	Best Cost	Worst Cost
Roofing	105	Pavilion Roof - Replace	25	23	\$3,000	\$4,000
	120	Pavilion Rain Gutters/Downspouts - Repl	N/A		\$0	\$0
Painted Surfaces	215	Pavilion - Repair/Repaint	10	8	\$1,200	\$1,800
Drive Materials	401	Asphalt - Major Rehab	30	26	\$180,000	\$240,000
	402	Asphalt - Seal Coat	5	0	\$23,000	\$26,000
	403	Concrete - Repair/Replace	10	4	\$4,000	\$6,000
Prop. Identification	801	Monument Signs - Replace	20	14	\$4,000	\$6,000
	803	Mailboxes - Replace	N/A		\$0	\$0
Fencing	1009	Split Rail Fencing - Replace	20	14	\$67,000	\$81,000
	1090	Brick Columns & Planter Boxes - Replac	N/A		\$0	\$0
Recreation Equip.	1301	Play Structures - 2015 - Replace	25	19	\$20,000	\$30,000
	1301	Play Structures - 2018 - Replace	25	24	\$70,000	\$90,000
	1303	Play Area Groundcover - Refill	5	2	\$8,000	\$12,000
	1307	Benches - Replace	15	9	\$34,000	\$48,000
	1309	Pergolas - Replace	30	27	\$30,000	\$40,000
Light Fixtures	1609	Street Light Fixtures - Replace	20	14	\$21,000	\$27,000
Landscaping	1812	Landscaping & Irrigation System - Renov	20	14	\$120,000	\$160,000

## Significant Components

ID #	Component Name	Useful Life (yrs.)	Remaining Useful Life (yrs.)	Average Current Cost	Significance: (Curr Cost/UL)	
					As \$	As %
105	Pavilion Roof - Replace	25	23	\$3,500	\$140	0.4007%
215	Pavilion - Repair/Repaint	10	8	\$1,500	\$150	0.4293%
401	Asphalt - Major Rehab	30	26	\$210,000	\$7,000	20.0343%
402	Asphalt - Seal Coat	5	0	\$24,500	\$4,900	14.0240%
403	Concrete - Repair/Replace	10	4	\$5,000	\$500	1.4310%
801	Monument Signs - Replace	20	14	\$5,000	\$250	0.7155%
1009	Split Rail Fencing - Replace	20	14	\$74,000	\$3,700	10.5896%
1301	Play Structures - 2015 - Replace	25	19	\$25,000	\$1,000	2.8620%
1301	Play Structures - 2018 - Replace	25	24	\$80,000	\$3,200	9.1586%
1303	Play Area Groundcover - Refill	5	2	\$10,000	\$2,000	5.7241%
1307	Benches - Replace	15	9	\$41,000	\$2,733	7.8229%
1309	Pergolas - Replace	30	27	\$35,000	\$1,167	3.3391%
1609	Street Light Fixtures - Replace	20	14	\$24,000	\$1,200	3.4345%
1812	Landscaping & Irrigation System - Rend	20	14	\$140,000	\$7,000	20.0343%

## Significant Components - Graph

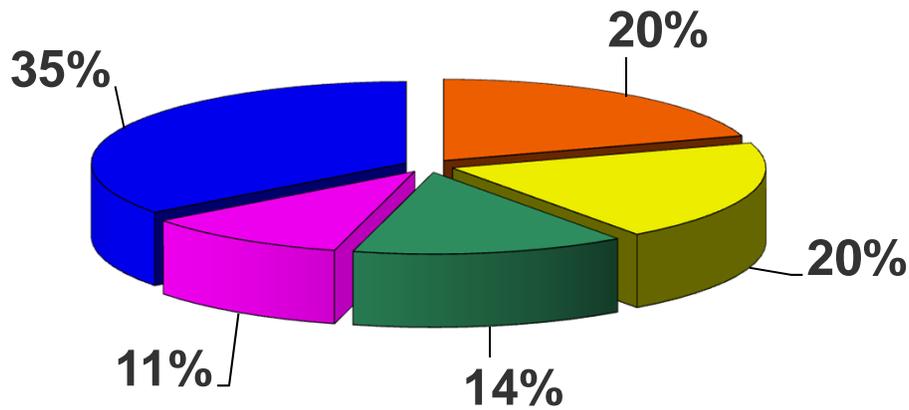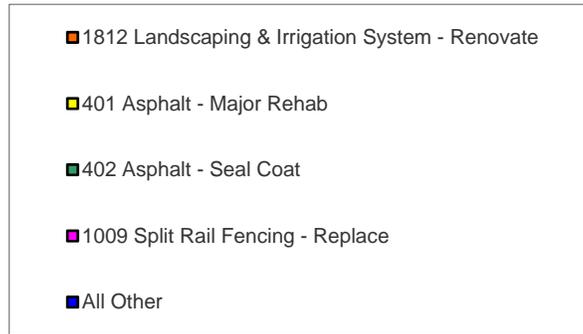

ID #	Component Name	Useful Life (yrs.)	Remaining Useful Life (yrs.)	Average Current Cost	Significance: (Curr Cost/UL)	
					As \$	As %
1812	Landscaping & Irrigation System - Ren	20	14	\$140,000	\$7,000	20%
401	Asphalt - Major Rehab	30	26	\$210,000	\$7,000	20%
402	Asphalt - Seal Coat	5	0	\$24,500	\$4,900	14%
1009	Split Rail Fencing - Replace	20	14	\$74,000	\$3,700	11%
All Other	See Expanded Table For Breakdown				\$12,340	35%

## Yearly Summary

Year	Fully Funded Balance	Starting Reserve Balance	% Funded	Reserve Contributions	Interest Income	Reserve Expenses	Ending Reserve Balance
2021	\$164,080	\$47,812	29%	\$48,000	\$60	\$24,500	\$71,372
2022	\$179,756	\$71,372	40%	\$49,440	\$96	\$0	\$120,908
2023	\$222,216	\$120,908	54%	\$50,923	\$141	\$10,609	\$161,363
2024	\$256,135	\$161,363	63%	\$52,451	\$188	\$0	\$214,002
2025	\$303,145	\$214,002	71%	\$54,024	\$238	\$5,628	\$262,637
2026	\$346,948	\$262,637	76%	\$55,645	\$276	\$28,402	\$290,156
2027	\$369,822	\$290,156	78%	\$57,315	\$319	\$0	\$347,790
2028	\$423,888	\$347,790	82%	\$59,034	\$371	\$12,299	\$394,896
2029	\$468,198	\$394,896	84%	\$60,805	\$425	\$1,900	\$454,226
2030	\$525,876	\$454,226	86%	\$62,629	\$459	\$53,496	\$463,818
2031	\$533,508	\$463,818	87%	\$64,508	\$480	\$32,926	\$495,880
2032	\$563,965	\$495,880	88%	\$66,443	\$529	\$0	\$562,853
2033	\$630,700	\$562,853	89%	\$68,437	\$590	\$14,258	\$617,622
2034	\$686,246	\$617,622	90%	\$70,490	\$653	\$0	\$688,764
2035	\$759,683	\$688,764	91%	\$72,604	\$538	\$375,122	\$386,784
2036	\$450,533	\$386,784	86%	\$74,782	\$405	\$38,170	\$423,802
2037	\$480,802	\$423,802	88%	\$77,026	\$463	\$0	\$501,290
2038	\$552,977	\$501,290	91%	\$79,337	\$533	\$16,528	\$564,631
2039	\$612,025	\$564,631	92%	\$81,717	\$604	\$2,554	\$644,399
2040	\$689,023	\$644,399	94%	\$84,168	\$665	\$43,838	\$685,395
2041	\$727,646	\$685,395	94%	\$86,693	\$707	\$44,250	\$728,545
2042	\$768,897	\$728,545	95%	\$89,294	\$774	\$0	\$818,613
2043	\$858,913	\$818,613	95%	\$91,973	\$855	\$19,161	\$892,280
2044	\$933,901	\$892,280	96%	\$94,732	\$937	\$6,908	\$981,041
2045	\$1,025,829	\$981,041	96%	\$97,574	\$902	\$256,132	\$823,386
2046	\$865,945	\$823,386	95%	\$100,501	\$848	\$51,298	\$873,438
2047	\$914,438	\$873,438	96%	\$103,516	\$699	\$452,884	\$524,769
2048	\$553,012	\$524,769	95%	\$106,622	\$528	\$99,958	\$531,961
2049	\$546,586	\$531,961	97%	\$109,821	\$585	\$3,432	\$638,935
2050	\$641,787	\$638,935	100%	\$113,115	\$696	\$0	\$752,746



# Reserve Contributions - Graph

## Monthly Reserve Contributions



## Component Funding Information

ID	Component Name	UL	RUL	Quantity	Average Current Cost	Ideal Balance	Current Fund Balance	Monthly
105	Pavilion Roof - Replace	25	23	Approx 800 Sq.ft.	\$3,500	\$280	\$0	\$16.03
215	Pavilion - Repair/Repaint	10	8	Approx 900 Sq.ft.	\$1,500	\$300	\$300	\$17.17
401	Asphalt - Major Rehab	30	26	Approx 119,585 Sq.ft.	\$210,000	\$28,000	\$0	\$801.37
402	Asphalt - Seal Coat	5	0	Approx 119,585 Sq.ft.	\$24,500	\$24,500	\$24,500	\$560.96
403	Concrete - Repair/Replace	10	4	Extensive Sq.ft.	\$5,000	\$3,000	\$3,000	\$57.24
801	Monument Signs - Replace	20	14	(6) Signs	\$5,000	\$1,500	\$0	\$28.62
1009	Split Rail Fencing - Replace	20	14	Approx 3,675 Linear ft.	\$74,000	\$22,200	\$0	\$423.58
1301	Play Structures - 2015 - Replace	25	19	(1) Playground	\$25,000	\$6,000	\$0	\$114.48
1301	Play Structures - 2018 - Replace	25	24	(2) Playgrounds	\$80,000	\$3,200	\$0	\$366.34
1303	Play Area Groundcover - Refill	5	2	Approx 7,250 Sq.ft.	\$10,000	\$6,000	\$6,000	\$228.96
1307	Benches - Replace	15	9	(34) Benches	\$41,000	\$16,400	\$14,012	\$312.92
1309	Pergolas - Replace	30	27	(2) Pergolas	\$35,000	\$3,500	\$0	\$133.56
1609	Street Light Fixtures - Replace	20	14	(27) Fixtures	\$24,000	\$7,200	\$0	\$137.38
1812	Landscaping & Irrigation System - Renovate	20	14	Extensive Sq.ft.	\$140,000	\$42,000	\$0	\$801.37
					<b>\$678,500</b>	<b>\$164,080</b>	<b>\$47,812</b>	<b>\$4,000</b>

Current Fund Balance as a percentage of Ideal Balance:      29%



## Yearly Cash Flow

Year	2021	2022	2023	2024	2025
<b>Starting Balance</b>	\$47,812	\$71,372	\$120,908	\$161,363	\$214,002
<i>Reserve Income</i>	\$48,000	\$49,440	\$50,923	\$52,451	\$54,024
<i>Interest Earnings</i>	\$60	\$96	\$141	\$188	\$238
<i>Special Assessments</i>	\$0	\$0	\$0	\$0	\$0
<b>Funds Available</b>	\$95,872	\$120,908	\$171,972	\$214,002	\$268,265
<b>Reserve Expenditures</b>	\$24,500	\$0	\$10,609	\$0	\$5,628
<b>Ending Balance</b>	\$71,372	\$120,908	\$161,363	\$214,002	\$262,637

Year	2026	2027	2028	2029	2030
<b>Starting Balance</b>	\$262,637	\$290,156	\$347,790	\$394,896	\$454,226
<i>Reserve Income</i>	\$55,645	\$57,315	\$59,034	\$60,805	\$62,629
<i>Interest Earnings</i>	\$276	\$319	\$371	\$425	\$459
<i>Special Assessments</i>	\$0	\$0	\$0	\$0	\$0
<b>Funds Available</b>	\$318,559	\$347,790	\$407,195	\$456,126	\$517,314
<b>Reserve Expenditures</b>	\$28,402	\$0	\$12,299	\$1,900	\$53,496
<b>Ending Balance</b>	\$290,156	\$347,790	\$394,896	\$454,226	\$463,818

Year	2031	2032	2033	2034	2035
<b>Starting Balance</b>	\$463,818	\$495,880	\$562,853	\$617,622	\$688,764
<i>Reserve Income</i>	\$64,508	\$66,443	\$68,437	\$70,490	\$72,604
<i>Interest Earnings</i>	\$480	\$529	\$590	\$653	\$538
<i>Special Assessments</i>	\$0	\$0	\$0	\$0	\$0
<b>Funds Available</b>	\$528,806	\$562,853	\$631,879	\$688,764	\$761,907
<b>Reserve Expenditures</b>	\$32,926	\$0	\$14,258	\$0	\$375,122
<b>Ending Balance</b>	\$495,880	\$562,853	\$617,622	\$688,764	\$386,784


Year	2036	2037	2038	2039	2040
<b>Starting Balance</b>	\$386,784	\$423,802	\$501,290	\$564,631	\$644,399
<i>Reserve Income</i>	\$74,782	\$77,026	\$79,337	\$81,717	\$84,168
<i>Interest Earnings</i>	\$405	\$463	\$533	\$604	\$665
<i>Special Assessments</i>	\$0	\$0	\$0	\$0	\$0
<b>Funds Available</b>	\$461,972	\$501,290	\$581,160	\$646,953	\$729,232
<b>Reserve Expenditures</b>	\$38,170	\$0	\$16,528	\$2,554	\$43,838
<b>Ending Balance</b>	\$423,802	\$501,290	\$564,631	\$644,399	\$685,395

Year	2041	2042	2043	2044	2045
<b>Starting Balance</b>	\$685,395	\$728,545	\$818,613	\$892,280	\$981,041
<i>Reserve Income</i>	\$86,693	\$89,294	\$91,973	\$94,732	\$97,574
<i>Interest Earnings</i>	\$707	\$774	\$855	\$937	\$902
<i>Special Assessments</i>	\$0	\$0	\$0	\$0	\$0
<b>Funds Available</b>	\$772,795	\$818,613	\$911,441	\$987,949	\$1,079,518
<b>Reserve Expenditures</b>	\$44,250	\$0	\$19,161	\$6,908	\$256,132
<b>Ending Balance</b>	\$728,545	\$818,613	\$892,280	\$981,041	\$823,386

Year	2046	2047	2048	2049	2050
<b>Starting Balance</b>	\$823,386	\$873,438	\$524,769	\$531,961	\$638,935
<i>Reserve Income</i>	\$100,501	\$103,516	\$106,622	\$109,821	\$113,115
<i>Interest Earnings</i>	\$848	\$699	\$528	\$585	\$696
<i>Special Assessments</i>	\$0	\$0	\$0	\$0	\$0
<b>Funds Available</b>	\$924,735	\$977,653	\$631,919	\$642,367	\$752,746
<b>Reserve Expenditures</b>	\$51,298	\$452,884	\$99,958	\$3,432	\$0
<b>Ending Balance</b>	\$873,438	\$524,769	\$531,961	\$638,935	\$752,746



## Yearly Reserve Expenditures - Graph

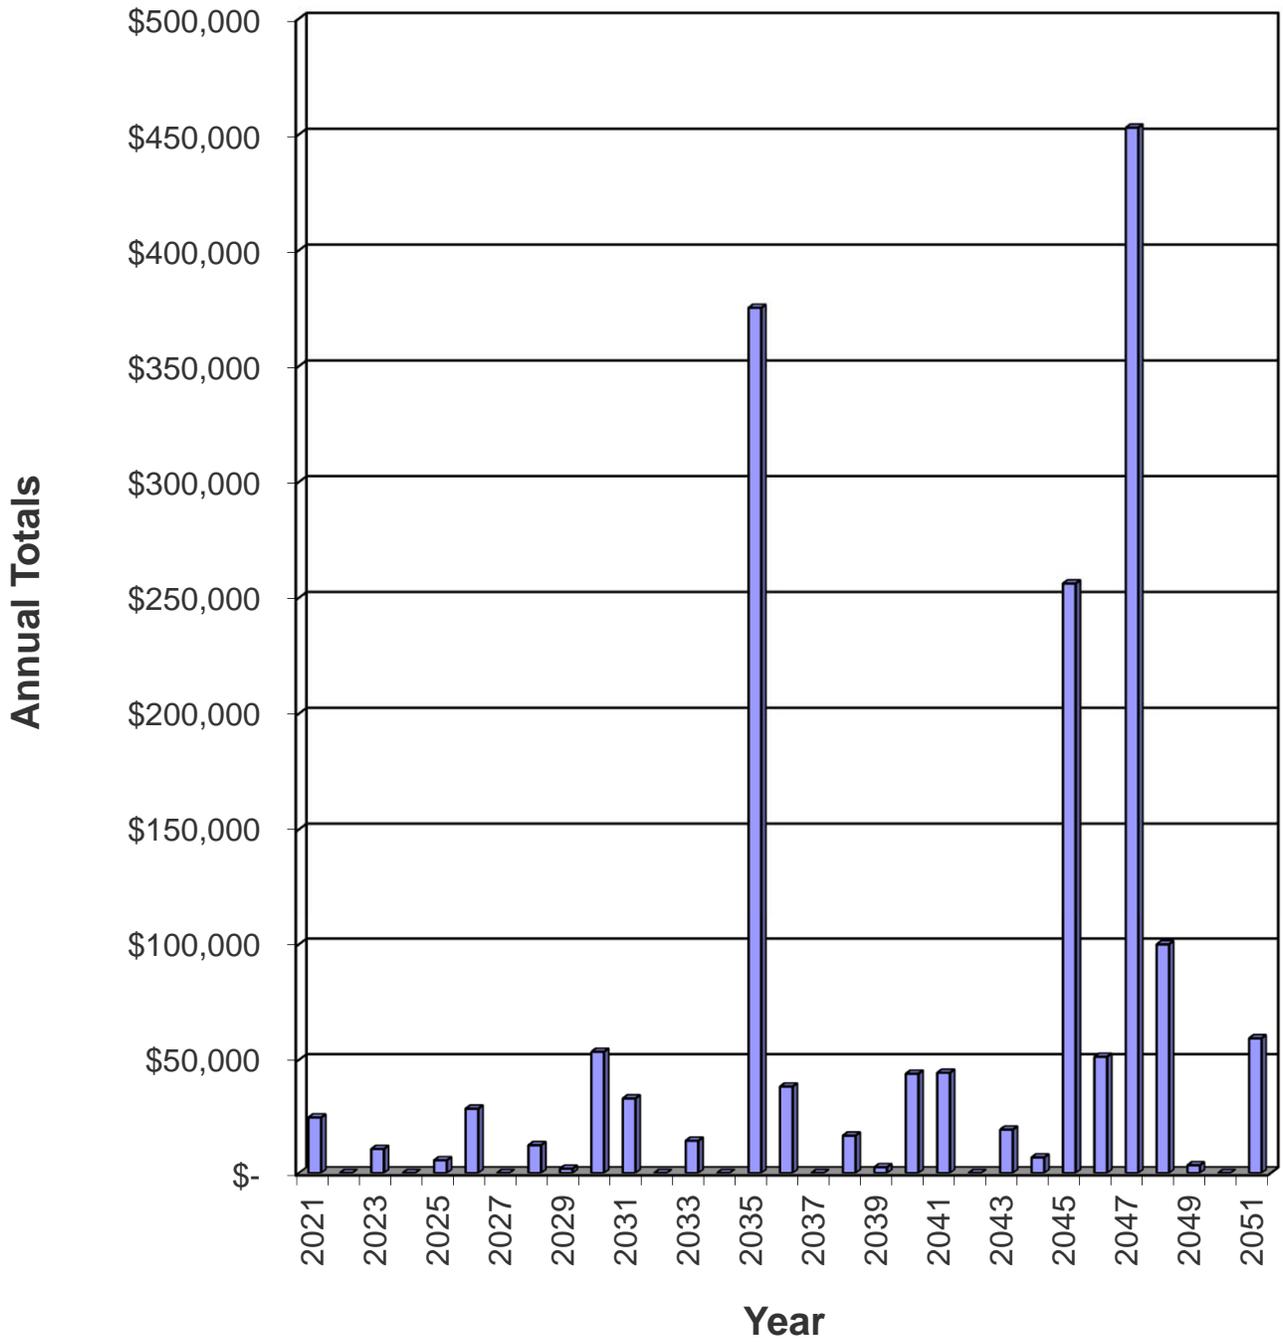

## Projected Reserve Expenditures by Year

Year	ID #	Component Name	Projected Cost	Total Per Annum
2021	402	Asphalt - Seal Coat	\$24,500	\$24,500
2022		No Expenditures Projected		\$0
2023	1303	Play Area Groundcover - Refill	\$10,609	\$10,609
2024		No Expenditures Projected		\$0
2025	403	Concrete - Repair/Replace	\$5,628	\$5,628
2026	402	Asphalt - Seal Coat	\$28,402	\$28,402
2027		No Expenditures Projected		\$0
2028	1303	Play Area Groundcover - Refill	\$12,299	\$12,299
2029	215	Pavilion - Repair/Repaint	\$1,900	\$1,900
2030	1307	Benches - Replace	\$53,496	\$53,496
2031	402	Asphalt - Seal Coat	\$32,926	\$32,926
2032		No Expenditures Projected		\$0
2033	1303	Play Area Groundcover - Refill	\$14,258	\$14,258
2034		No Expenditures Projected		\$0
2035	403	Concrete - Repair/Replace	\$7,563	
	801	Monument Signs - Replace	\$7,563	
	1009	Split Rail Fencing - Replace	\$111,932	
	1609	Street Light Fixtures - Replace	\$36,302	
	1812	Landscaping & Irrigation System - Renovate	\$211,763	\$375,122
2036	402	Asphalt - Seal Coat	\$38,170	\$38,170
2037		No Expenditures Projected		\$0
2038	1303	Play Area Groundcover - Refill	\$16,528	\$16,528
2039	215	Pavilion - Repair/Repaint	\$2,554	\$2,554
2040	1301	Play Structures - 2015 - Replace	\$43,838	\$43,838
2041	402	Asphalt - Seal Coat	\$44,250	\$44,250
2042		No Expenditures Projected		\$0
2043	1303	Play Area Groundcover - Refill	\$19,161	\$19,161
2044	105	Pavilion Roof - Replace	\$6,908	\$6,908
2045	403	Concrete - Repair/Replace	\$10,164	
	1301	Play Structures - 2018 - Replace	\$162,624	
	1307	Benches - Replace	\$83,345	\$256,132
2046	402	Asphalt - Seal Coat	\$51,298	\$51,298
2047	401	Asphalt - Major Rehab	\$452,884	\$452,884
2048	1303	Play Area Groundcover - Refill	\$22,213	
	1309	Pergolas - Replace	\$77,745	\$99,958
2049	215	Pavilion - Repair/Repaint	\$3,432	\$3,432
2050		No Expenditures Projected		\$0

# Component Evaluation

Comp #: 105 Pavilion Roof - Replace



*Location:* Pavilion Roof

*Quantity:* Approx 800 Sq.ft.

*Life Expectancy:* 25 *Remaining Life:* 23

*Best Cost:* \$3,000

Estimate to replace

*Worst Cost:* \$4,000

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The roof is in good condition. We recommend funding to replace this component approximately every 20 - 25 years. Remaining life based on current age.

*General Notes:*

Comp #: 120 Pavilion Rain Gutters/Downspouts - Replace



*Location:* Pavilion Exterior

*Quantity:* Approx 125 Linear ft.

*Life Expectancy:* N/A *Remaining Life:*

*Best Cost:* \$0

*Worst Cost:* \$0

*Source of Information:*

*Observations:*

The rain gutters and downspouts are in good condition. We recommend funding to replace this component approximately every 25 - 30 years. Remaining life based on current age.

*General Notes:*

Comp #: 215 Pavilion - Repair/Repaint



*Location:* Pavilion Exterior

*Quantity:* Approx 900 Sq.ft.

*Life Expectancy:* 10 *Remaining Life:* 8

*Best Cost:* \$1,200

Estimate to repair/repaint

*Worst Cost:* \$1,800

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The painted surfaces are in good condition. We recommend funding to repair/repaint this component approximately every 8 - 10 years. Remaining life is based on current age.

*General Notes:*

Comp #: 401 Asphalt - Major Rehab



*Location:* **Community Alleys**

*Quantity:* **Approx 119,585 Sq.ft.**

*Life Expectancy:* **30** *Remaining Life:* **26**

*Best Cost:* **\$180,000**

Estimate for major rehab

*Worst Cost:* **\$240,000**

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The asphalt surfaces are generally in good condition. We recommend funding for a major rehab of this component approximately every 25 - 30 years. Remaining life based on current average age.

*General Notes:*

Comp #: 402 Asphalt - Seal Coat



*Location:* **Community Alleys**

*Quantity:* **Approx 119,585 Sq.ft.**

*Life Expectancy:* **5** *Remaining Life:* **0**

*Best Cost:* **\$23,000**

Estimate for seal coat

*Worst Cost:* **\$26,000**

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The asphalt seal coat is in fair to poor condition. We recommend funding to seal this component approximately every 3 - 5 years. Remaining life based on current condition.

*General Notes:*

Comp #: 403 Concrete - Repair/Replace



*Location:* **Sidewalks**

*Quantity:* **Extensive Sq.ft.**

*Life Expectancy:* **10** *Remaining Life:* **4**

*Best Cost:* **\$4,000**

Allowance to repair/replace

*Worst Cost:* **\$6,000**

Higher allowance

*Source of Information:* CSL Cost Database

*Observations:*

The concrete is generally in good condition. This component has an extended useful life under normal conditions. We recommend funding to make repairs and partially replace this component approximately every 10 years. Remaining life based on current age.

*General Notes:*

Comp #: 801 Monument Signs - Replace



*Location:* **Common Area**

*Quantity:* **(6) Signs**

*Life Expectancy:* **20** *Remaining Life:* **14**

*Best Cost:* **\$4,000**

Estimate to replace

*Worst Cost:* **\$6,000**

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The monument signs are in good to fair condition. We recommend funding to replace this component approximately every 15 - 20 years. Remaining life is based on current age.

*General Notes:*

Comp #: 803 Mailboxes - Replace



*Location:* **Common Area**

*Quantity:* **(19) Clusters**

*Life Expectancy:* **N/A** *Remaining Life:*

*Best Cost:* **\$0**

*Worst Cost:* **\$0**

*Source of Information:*

*Observations:*

Typically these mailboxes are owned and maintained by the postal service. No reserve funding necessary.

*General Notes:*

Comp #: 1009 Split Rail Fencing - Replace



*Location:* **Common Area**

*Quantity:* **Approx 3,675 Linear ft.**

*Life Expectancy:* **20** *Remaining Life:* **14**

*Best Cost:* **\$67,000**

Estimate to replace

*Worst Cost:* **\$81,000**

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The split rail fencing is in good to fair condition. We recommend funding to replace this component approximately every 15 - 20 years. Remaining life based on current age.

*General Notes:*

Comp #: 1090 Brick Columns & Planter Boxes - Replace



*Location:* **Common Area**

*Quantity:* **(37) Columns & Planters**

*Life Expectancy:* **N/A** *Remaining Life:*

*Best Cost:* **\$0**

*Worst Cost:* **\$0**

*Source of Information:*

*Observations:*

This component has an extended useful life under normal conditions. Repair as necessary as an operating expense. No reserve funding necessary.

*General Notes:*

Comp #: 1301 Play Structures - 2015 - Replace



*Location:* **Southwest Play Area**

*Quantity:* **(1) Playground**

*Life Expectancy:* **25** *Remaining Life:* **19**

*Best Cost:* **\$20,000**

Estimate to replace

*Worst Cost:* **\$30,000**

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The play structures are in good condition. We recommend funding to replace this component approximately every 20 - 25 years. Remaining life based on current age.

*General Notes:*

Comp #: 1301 Play Structures - 2018 - Replace



*Location:* **North & Southeast Play Areas**

*Quantity:* **(2) Playgrounds**

*Life Expectancy:* **25** *Remaining Life:* **24**

*Best Cost:* **\$70,000**

Estimate to replace

*Worst Cost:* **\$90,000**

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The play structures are in good condition. We recommend funding to replace this component approximately every 20 - 25 years. Remaining life based on current age.

*General Notes:*

Comp #: 1303 Play Area Groundcover - Refill



*Location:* **Play Area**

*Quantity:* **Approx 7,250 Sq.ft.**

*Life Expectancy:* **5** *Remaining Life:* **2**

*Best Cost:* **\$8,000**

Estimate to refill

*Worst Cost:* **\$12,000**

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The play area groundcover is in good to fair condition. We recommend funding to refill this component approximately every 3 - 5 years. Remaining life is based on current age.

*General Notes:*

Comp #: 1307 Benches - Replace



*Location:* **Common Area**

*Quantity:* **(34) Benches**

*Life Expectancy:* **15** *Remaining Life:* **9**

*Best Cost:* **\$34,000**

Estimate to replace

*Worst Cost:* **\$48,000**

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The benches are in good condition. We recommend funding to replace this component approximately every 15 - 20 years. Paint as necessary as an operating expense. Remaining life based on current age.

*General Notes:*

Comp #: 1309 Pergolas - Replace



*Location:* **Common Area**

*Quantity:* **(2) Pergolas**

*Life Expectancy:* **30** *Remaining Life:* **27**

*Best Cost:* **\$30,000**

Estimate to replace

*Worst Cost:* **\$40,000**

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The pergolas are in good condition. We recommend funding to replace this component approximately every 25 - 30 years. Remaining life based on current age.

*General Notes:*

Comp #: 1609 Street Light Fixtures - Replace



*Location:* **Common Area**

*Quantity:* **(27) Fixtures**

*Life Expectancy:* **20** *Remaining Life:* **14**

*Best Cost:* **\$21,000**

Estimate to replace

*Worst Cost:* **\$27,000**

Higher estimate

*Source of Information:* CSL Cost Database

*Observations:*

The street light fixtures are in good condition. No expectation to replace the light poles. Paint poles as necessary as an operating expense. We recommend funding to replace this component approximately every 20 years. Remaining life based on current age.

*General Notes:*

Comp #: 1812 Landscaping & Irrigation System - Renovate



*Location:* **Common Area**

*Quantity:* **Extensive Sq.ft.**

*Life Expectancy:* **20** *Remaining Life:* **14**

*Best Cost:* **\$120,000**

Allowance to renovate

*Worst Cost:* **\$160,000**

Higher allowance

*Source of Information:* CSL Cost Database

*Observations:*

The landscaping and irrigation system are in good condition. We recommend funding for an allowance to renovate the landscaping and irrigation system approximately every 20 years. Remaining life based on current age.

*General Notes:*

## Glossary of Commonly Used Words And Phrases

(Provided by the National Reserve Study Standards of the Community Associations Institute)

**Cash Flow Method** – A method of developing a reserve funding plan where contributions to the reserve fund are designed to offset the variable annual expenditures from the reserve fund. Different reserve funding plans are tested against the anticipated schedule of reserve expenses until the desired funding goal is achieved.

**Component** – Also referred to as an “Asset.” Individual line items in the Reserve Study developed or updated in the physical analysis. These elements form the building blocks for the Reserve Study. Components typically are: 1) Association responsibility, 2) with limited useful life expectancies, 3) have predictable remaining life expectancies, 4) above a minimum threshold cost, and 5) required by local codes.

**Component Full Funding** – When the actual (or projected) cumulative reserve balance for all components is equal to the fully funded balance.

**Component Inventory** – The task of selecting and quantifying reserve components. This task can be accomplished through on-site visual observations, review of association design and organizational documents, a review of established association precedents, and discussion with appropriate association representatives.

**Deficit** – An actual (or projected reserve balance), which is less than the fully funded balance.

**Effective Age** – The difference between useful life and remaining useful life (UL - RUL).

**Financial Analysis** – The portion of the Reserve Study where current status of the reserves (measured as cash or percent funded) and a recommended reserve contribution rate (reserve funding plan) are derived, and the projected reserve income and expenses over time is presented. The financial analysis is one of the two parts of the Reserve Study.

**Fully Funded Balance** – An indicator against which the actual (or projected) reserve balance can be compared. The reserve balance that is in direct proportion to the fraction of life “used up” of the current repair or replacement cost of a reserve component. This number is calculated for each component, and then summed together for an association total.

$$\text{FFB} = \text{Current Cost} * \text{Effective Age} / \text{Useful Life}$$

**Fund Status** – The status of the reserve fund as compared to an established benchmark, such as percent funded.

**Funding Goals** – Independent of calculation methodology utilized, the following represent the basic categories of funding plan goals:

- *Baseline Funding*: Establishing a reserve-funding goal of keeping the reserve balance above zero.
- *Component Full Funding*: Setting a reserve funding goal of attaining and maintaining cumulative reserves at or near 100% funded.
- *Threshold Funding*: Establishing a reserve funding goal of keeping the reserve balance above a specified dollar or percent funded amount.

**Funding Plan** – An association’s plan to provide income to a reserve fund to offset anticipated expenditures from that fund.



**Funding Principles –**

- Sufficient funds when required
- Stable contributions through the year
- Evenly distributed contributions over the years
- Fiscally responsible

**GSF - Gross Square Feet**

**Life and Valuation Estimates** – The task of estimating useful life, remaining useful life, and repair or replacement costs for the reserve components.

**LF - Linear Feet**

**Percent Funded** – The ratio, at a particular point in time (typically the beginning of the fiscal year), of the actual (or projected) reserve balance to the ideal fund balance, expressed as a percentage.

**Physical Analysis** – The portion of the Reserve Study where the component evaluation, condition assessment, and life and valuation estimate tasks are performed. This represents one of the two parts of the Reserve Study.

**Remaining Useful Life (RUL)** – Also referred to as “remaining life” (RL). The estimated time, in years, that a reserve component can be expected to continue to serve its intended function. Projects anticipated to occur in the current fiscal year have a “0” remaining useful life.

**Replacement Cost** – The cost of replacing, repairing, or restoring a reserve component to its original functional condition. The current replacement cost would be the cost to replace, repair, or restore the component during that particular year.

**Reserve Balance** – Actual or projected funds as of a particular point in time (typically the beginning of the fiscal year) that the association has identified for use to defray the future repair or replacement of those major components that the association is obligated to maintain. Also known as “reserves,” “reserve accounts,” or “cash reserves.” In this report the reserve balance is based upon information provided and is not audited.

**Reserve Study** – A budget-planning tool, which identifies the current status of the reserve fund and a stable and equitable funding plan to offset the anticipated future major common area expenditures. The Reserve Study consists of two parts: The Physical Analysis and the Financial Analysis.

**Special Assessment** – An assessment levied on the members of an association in addition to regular assessments. Governing documents or local statutes often regulate special assessments.

**Surplus** – An actual (or projected) reserve balance that is greater than the fully funded balance.

**Useful Life (UL)** – Also known as “life expectancy.” The estimated time, in years, that a reserve component can be expected to serve its intended function if properly constructed and maintained in its present application of installation.

